


Repair Parts Sheet

10887,10888,10889,10891

Rev. 0609

INSTALL ALL KIT COMPONENTS TO INSURE A COMPLETE AND PROPER REPAIR OF THE CYLINDER.

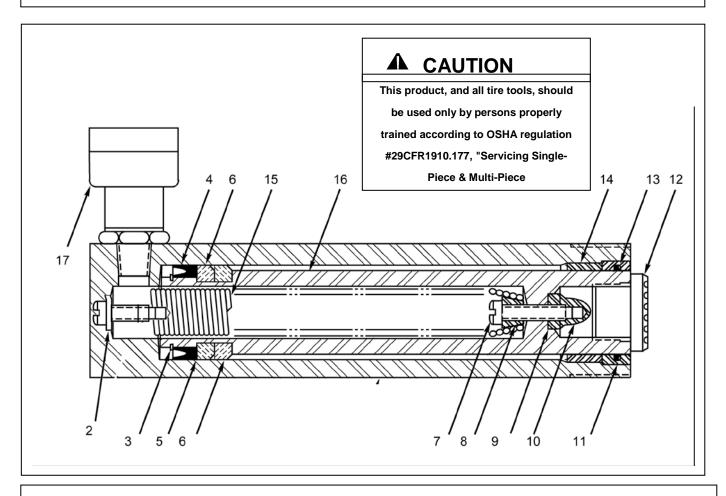

Note: Rod bearings (Item 6) to be assembled with splits staggered 90° apart.

Note: Model 10888 do not have a Bushing, Gasket, Acorn Nut or Bearing Sleeve due to their lower stroke. These models have only one set of Rod Bearings.

Note: Cylinder Base, Item #1, is not available as a service item. Order complete cylinder.

SPECIFICATIONS							
Description	10887	10888	10889	10891			
Rated Capacity	10 Ton	10 Ton	10 Ton	10 Ton			
Plunger Stroke	21/8 Inch	4	6 ¼"	101/4 Inch			
Hydraulic Pressure	10,000 psi	10,000 psi	10,000 psi	10,000 psi			





Repair Parts Sheet

10887, 10888, 10889, 10891

Repair Parts Sheet								
Item No.	10887	10888	10889	10891	Qty.	Description		
2	*	*	*	*	1	Screw 1/4-28 UNF X 1"		
3	*	*	*	*	1	Retaining Ring		
4	*	*	*	*	1	U-Cup		
5	*	*	*	*	1	Washer		
6	G382107 (1)	G382107 (1)	G382107	G382107	2	Rod Bearing		
7	DA2286028	DA2286028	(See Note A)	(See Note A)	1	Screw		
8	Not Required		F948209	F948209	1	Bushing		
9			*	*	1	Gasket		
10			G833055	G833055	1	Acorn Nut		
11	G385044		G385044	G385044	1	Bearing Stop Ring		
12	A102G		A102G	A102G	1	Saddle Assembly		
13	*	*	*	*	1	Wiper		
14			G831446	G831446	1	Bearing Sleeve		
15	L202110SR	CB425110SR	F937110SR	F938110SR	1	Spring (incl. item 7,8,9,10)		
16	DA2283040	DA2284040	G838040	G830040	1	Plunger		
17	10606	10606	10606	10606	1	Half Coupler		
	CD-411	CD-411	CD-411	CD-411	1	Dust Cap (not shown)		

Note A: 10891 uses a 1/4-28 UNF X 1 1/4 long.

[☐] Indicates items included in, and available only as part of Repair Kit RC102K.