


Master Copy

ENERPAC®

the new Blackhawk Industrial Line


REPAIR PARTS SHEET

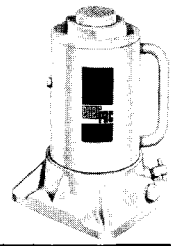

MODEL JH-30

October 1964

Rated Capacity ... 30 Ton
Plunger Stroke ... 6 1/4"

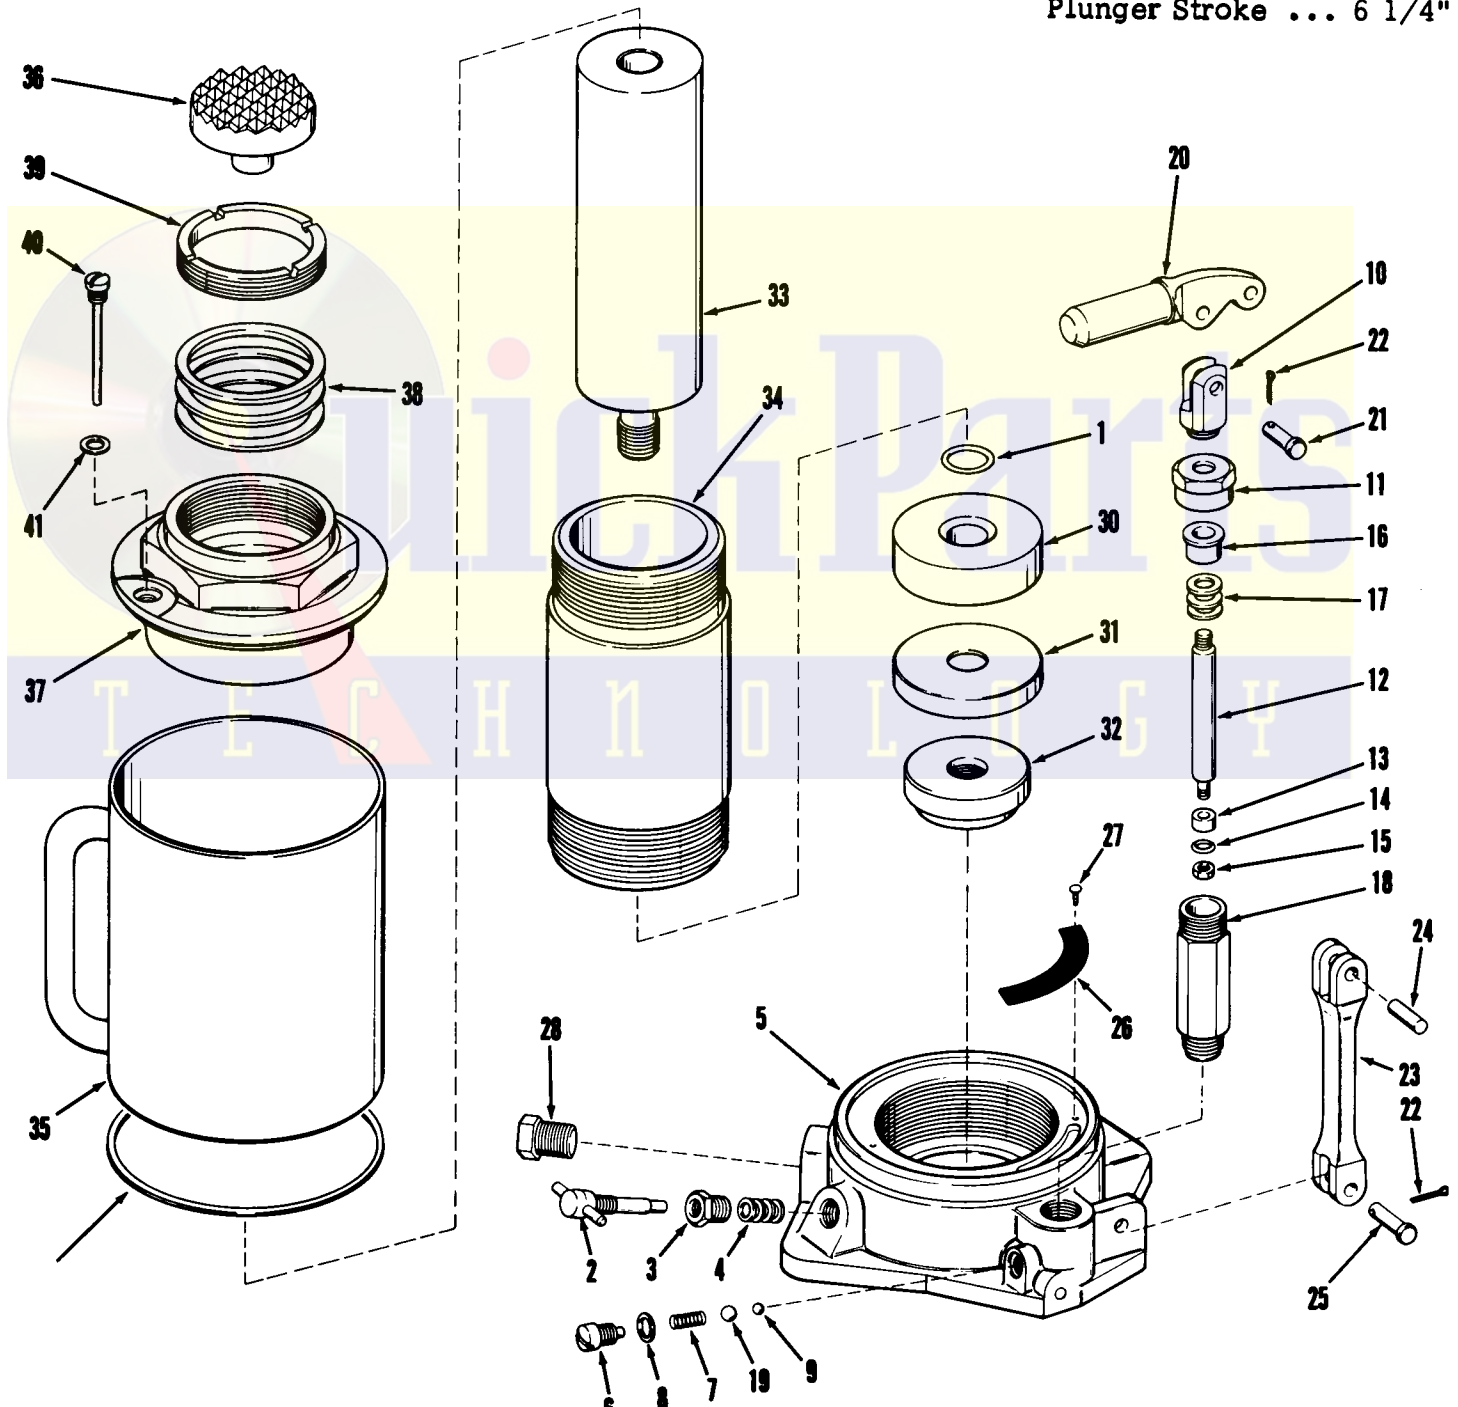

TO PROTECT YOUR WARRANTY, USE ONLY ENERPAC HYDRAULIC OIL.

PARTS LIST FOR MODEL JH-30

| Item No. | Part Name | No. | Req'd. Part No. | Item No. | Part Name | No. | Req'd. Part No. |
|----------|-------------------------|-----|-----------------|----------|------------------------|-----|-----------------|
| 1 | "O" Ring | 1 | W293.504 | 27 | Drive Screw | 2 | W78.03 |
| 2 | Release Valve Assem. | 1 | D11.10A | | Name Plate | 1 | C14.026 |
| 3 | Packing Nut | 1 | E11.11 | | Drive Screw | | |
| 4 | R. V. Packing | 4 | D11.74 | | (Used on Name Plate) | 2 | W78.03 |
| 5 | Base | 1 | FA11.05A | 28 | Pipe Plug | 1 | P5.245-1 |
| 6 | Valve Plug | 1 | CB9.185 | 29 | Reservoir Gasket | 1 | C519.037 |
| 7 | Outlet Valve Spring | 1 | S1.183 | 30 | Disc | 1 | FA11.71 |
| 8 | Valve Plug Gasket | 1 | B159.167 | 31 | Plunger Cup | 1 | FA11.41-1 |
| 9 | 7/32" Ball | 1 | 1.16 | 32 | Plunger Cup Spreader | 1 | FB11.43 |
| 10 | Clevis | 1 | 1.56 | 33 | Plunger | 1 | FA11.40 |
| 11 | Gland Nut | 1 | F11.54 | 34 | Cylinder | 1 | FA11.30 |
| 12 | Pump Plunger | 1 | 5.51 | 35 | Reservoir | 1 | FB11.25A |
| 13 | Pump Cup | 1 | F11.53 | 36 | Saddle | 1 | FB11.45-1 |
| 14 | Pump Cup Spreader | 1 | F11.52 | 37 | Top Cap | 1 | FA11.20 |
| 15 | Pump Cup Retaining Nut | 1 | CB9.55 | 38 | Plunger Packing | 3 | FA11.76 |
| 16 | Pump Packing Gland Ring | 1 | F11.59 | 39 | Gland Nut | 1 | FA11.21 |
| 17 | Pump Packing | 3 | F11.75 | 40 | Filler Gauge | 1 | F11.22A |
| 18 | Pump Cylinder | 1 | F11.50 | 41 | Filler Plug Gasket | 1 | C9.37 |
| 19 | 5/16" Ball | 1 | S1.16 | | Jack Handle | 1 | H-3 |
| 20 | Beam | 1 | 5.60 | | Decal "Instruction" | 1 | C41.026 |
| 21 | Clevis Pin | 1 | 1.57-1 | | Decal "Identification" | 1 | C44.026 |
| 22 | Cotter Pin | 2 | 1.58 | | Pump Assembly | | |
| 23 | Link | 1 | D11.62 | | (Items 10-18) | | F11.50A |
| 24 | Link Rivet | 1 | CB9.63 | | Pump Plunger Assembly | | |
| 25 | Link Pin | 1 | CB9.57 | | (Items 12-15) | | F11.51A |
| 26 | Oil Strainer Screen | 1 | FA11.18 | | Jack/Saver Repair Kit | | FA11K-3 |

NOTE: Orders for parts cannot be filled unless both model and serial number with prefix imprinted on nameplate are given.

FRANCHISED SERVICE DEPOTS



For quality workmanship with genuine Enerpac parts select a Franchised Blackhawk Service Depot for your repair work. Only repairs performed by a Franchised Service Depot displaying this official sign are backed with full factory guarantee. The Classified Section in your Phone Book lists your nearest Franchised Service Depot.

GUARANTEE

Enerpac guarantees its Products against defects in workmanship and materials for 90 days from date of delivery to the user. Only exception is chain, which follows the trade custom of its manufacturers and cannot be guaranteed.

When question of warranty arises, the user should send his unit to the nearest Franchised Service Depot for inspection, transportation to be prepaid and evidence of delivery date furnished.

If the difficulty comes under the terms of our guarantee, the Franchised Service Depot will repair or replace parts affected and return prepaid. Our guarantee does not cover ordinary wear and tear, abuse, misuse, overloading, altered products or use of improper fluid.

PARTS, SERVICE INFORMATION AND THE ADMINISTRATION OF FRANCHISED SERVICE DEPOTS FOR ENERPAC PRODUCTS IS PROVIDED BY —

BLACKHAWK SERVICE

MILWAUKEE, WISCONSIN 53246

DIVISION OF APPLIED POWER INDUSTRIES, INC.

Please direct all Service Correspondence to BLACKHAWK SERVICE

© Applied Power Industries, Inc. 1964